Autonics

INDUCTIVE PROXIMITY SENSOR LONG DISTANCE CYLINDRICAL TYPE DC 3WIRE



Thank you very much for selecting Autonics products. For your safety, please read the following before using.

Caution for your safety

*Please keep these instructions and review them before using this unit.

*Please observe the cautions that follow;

Marning Serious injury may result if instructions are not followed.

Caution Product may be damaged, or injury may result if instructions are not followed.

*The following is an explanation of the symbols used in the operation manual.

▲Caution:Injury or danger may occur under special conditions


∧Warning

1. In case of using this unit with machineries(Nuclear power control, medical equipment vehicle, train, airplane, combustion apparatus, entertainment or safety device etc), it requires installing fail-safe device, or contact us for information on type required. It may result in serious damage, fire or human injury.


∧Caution

- 1. Do not use this unit in place where there are flammable, explosive gas, chemical or strong alkalis, acids. t may cause a fire or explosion
- 2. Do not impact on this unit.
- may result in malfunction or damage to the product
- 3. Do not apply AC power and observe specification rating. It may result in serious damage to the product.

Ordering information

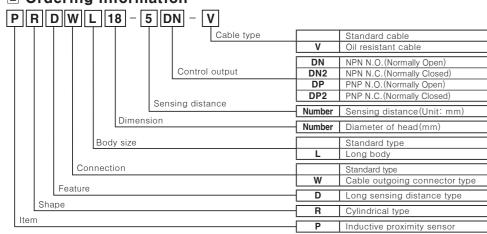

Control output diagram & Load operating

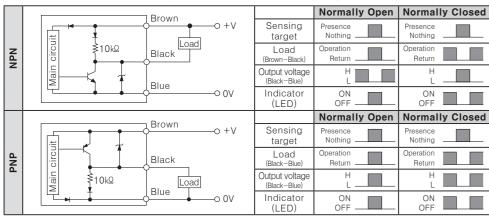

* The above specifications are subject to change without notice.

Specifications

Model	PRD12-4DN PRD12-4DP PRD12-4DP2 PRD12-4DP2 PRD12-4DP2 PRDL12-4DP PRDL12-4DP PRDL12-4DP2 PRDW12-4DP PRDW12-4DP PRDW12-4DP2 PRDW12-4DP2 PRDW12-4DP2 PRDW12-4DP2 PRDW12-4DP2 PRDW12-4DP2 PRDW12-4DP2 PRDW12-4DP2 PRDW12-4DP2 PRDW12-4DP2 PRDW12-4DP2 PRDW12-4DP2 PRDW12-4DP2 PRDW12-4DP2 PRDW12-4DP2 PRDW12-4DP2 PRDW12-4DP2	PRD12-8DN PRD12-8DP PRD12-8DN2 PRD12-8DN2 PRD12-8DN9 PRDL12-8DN PRDL12-8DN2 PRDU12-8DN2 PRDW12-8DP2 PRDW12-8DP2 PRDW12-8DP2 PRDW12-8DP2 PRDW12-8DP2 PRDW12-8DP2 PRDW12-8DP2 PRDW12-8DP2 PRDW12-8DP2 PRDW12-8DP2 PRDW12-8DP2 PRDW12-8DP2 PRDW12-8DP2 PRDW12-8DP2 PRDW12-8DP2 PRDW12-8DP2 PRDW12-8DP2 PRDW12-8DP2 PRDW12-8DP2	PRD18-7DN PRD18-7DP PRD18-7DN2 PRD18-7DN2 PRD18-7DNP PRDL18-7DN PRDL18-7DP PRDL18-7DP2 PRDU18-7DP2 PRDW18-7DP2 PRDW18-7DP-V	PRD18-14DN PRD18-14DP PRD18-14DP2 PRD18-14DP2 PRD18-14DP PRD118-14DN PRD118-14DN PRD118-14DN PRD118-14DN PRDW18-14DN PRDW18-14DN PRDW18-14DP2 PRDW18-14DP2 PRDW18-14DP2 PRDW18-14DP2 PRDW18-14DP2 PRDW18-14DP2 PRDW18-14DP2 PRDW18-14DP2 PRDW18-14DP2 PRDW18-14DP2 PRDW18-14DP2 PRDW18-14DP2 PRDW18-14DP2 PRDW18-14DP2	PRD30-15DN PRD30-15DN PRD30-15DN2 PRD30-15DN2 PRD130-15DN PRDL30-15DN PRDL30-15DN2 PRD130-15DN2 PRDW30-15DN2 PRDW30-15DN2 PRDW30-15DN2 PRDW30-15DN2 PRDW130-15DN2 PRDW130-15DN2 PRDW130-15DN2 PRDW130-15DN2 PRDW130-15DN2 PRDW130-15DN2 PRDW130-15DN2 PRDW130-15DN2 PRDW130-15DN2 PRDW30-15DN2 PRDW30-15DN2 PRDW30-15DN2 PRDW30-15DN2 PRDW30-15DN2 PRDW30-15DN-V	PRD30-25DN PRD30-25DP PRD30-25DP2 PRD30-25DP2 PRDL30-25DP PRDL30-25DP PRDL30-25DP2 PRDW30-25DP2 PRDW30-25DP2 PRDW30-25DP2 PRDW30-25DP2 PRDW130-25DP2 PRDW130-25DP2 PRDW130-25DP2 PRDW130-25DP2 PRDW130-25DP2 PRDW130-25DP2 PRDW130-25DP2 PRDW130-25DP2 PRDW130-25DP2 PRDW30-25DP2 PRDW30-25DP2 PRDW30-25DP2 PRDW30-25DP2 PRDW30-25DP2 PRDW30-25DP2 PRDW30-25DP-V		
Sensing distance	4mm	8mm	7mm	14mm	15mm	25mm		
Hysteresis	ļ		Max. 10% of s	ensing distance				
Standard sensing target	12×12×1mm(Iron)	25×25×1mm(Iron)	20×20×1mm(Iron)	40×40×1mm(Iron)	45×45×1mm(Iron)	75×75×1mm(Iron)		
Setting distance	0~2.8mm	0~5.6mm	0~4.9mm	0~9.8mm	0 ~ 10.5mm	0 ~ 17.5mm		
Power supply (Operating voltage)	12-24VDC(10-30VDC)							
Current consumption		Max. 10mA						
Response frequency(#1)	500Hz	400Hz	300Hz	200Hz	100Hz	100Hz		
Residual voltage			Max.	1.5V				
Affection by Temp.		Within ±10℃ max	of sensing distance a	t 20℃ in temperature ra	ange of -25 ~ 70℃			
Control output			Max.	200mA				
Insulation resistance			Min. 50MΩ(500	OVDC megger)				
Dielectric strength			1,500VAC 50/6	OHz for 1minute				
Vibration		1mm amplitude at fre	quency of 10 ~ 55Hz	in each of X, Y, Z d	irections for 2 hours			
Shock			500mଟ(50G) X, Y, Z	directions for 3 times				
Indicator			Operating indi	cator(Red LED)				
Ambient temperature Ambient humidity			-25 ~ 70℃, Sto	rage: -30 ~ 80℃				
Ambient humidity			35 ~ 95%RH, Sto	rage: 35 ~ 95%RH				
Protection circuit		surge protection, R	everse polarity prote	citon, overload & sh	ort circuit protection			
Protection			IP67(IEC	Standards)				
Materials				ated Iron, Sensing su sistant cable(Gray): (
Approval				E				
Unit Weight	PRD: Approx. 74g PRDL: Approx. 94g PRDW: Approx. 44g PRDWL: Approx. 64g	PRD: Approx.72g PRDL: Approx. 92g PRDW: Approx. 42g PRDWL: Approx. 62g	PRD: Approx. 115g PRDL: Approx. 145g PRDW: Approx. 80g	PRD: Approx. 110g PRDL: Approx. 140g PRDW: Approx. 75g PRDWL: Approx. 105g	PRD: Approx. 175g PRDL: Approx. 215g PRDW: Approx. 140g PRDWL: Approx. 180g	PRD: Approx. 180g PRDL: Approx. 220g PRDW: Approx. 145g PRDWL: Approx. 185g		

- at: The response frequency is the average value. The standard sensing target is used and the width is set as 2 times of the standard sensing target, 1/2 of the sensing distance for the distance.
- Environment resistance is rated at no freezing or condensation.

Dimensions

וט	(Unit:									Unit:mm)			
Tuna	Cable outgoing type Cable outgoing connector type							NIA O I	Maahau				
Type		PRD,PR	DL(M12,	M18, M3	0)		PRDW,PRDWL(M12, M18, M30)					Nut & Washer	
Flush		C D		₩G 	→		C D D A	*1		H M12×1	- }]-		 K
Non- flush		C F D	A	#G 	<u>→</u>	-	B *G C F D M12×1						
	Туре		Α	В	С	D	Е	F	G	Н	J	K	L
		PRD	M12×1	51.8	33.5	31.5	4	_	2,000	_	4		m
	M12	PRDW	M12×1	51.8	33.5	31.5	4		300	44	4	17	21
		PRDL	M12×1	64.3	46	44	4		2,000	_	4		-'
	\vdash	PRDWL	M12×1	64.3	46	44	4		300	44	4		\sqcup
		PRD	M18×1	53.2	31.5 31.5	29.5 29.5	4		2,000	-	5		
Flush	M18	PRDW	M18×1	53.2					300	44	5	24	29
		PRDL PRDWL	M18×1 M18×1	85.7 85.7	64 64	62 62	4		2,000 300	44	5 5		
	\vdash	PRD	M30×1.5	62	40.3	38	5	_	2,000	44	5		\vdash
		PRDW	M30×1.5	62	40.3	38	5		300	44	5		
	M30	PRDL	M30×1.5	84	62.3	60	5	-	2,000		5	35	42
	1 1	PRDWL	M30×1.5	84	62.3	60	5		300	44	5		
		PRD	M12×1	51.8	33.5	24.5	4	7	2,000		4		
	l	PRDW	M12×1	51.8	33.5	24.5	4	7	300	44	4		
	M12	PRDL	M12×1	64.3	46	37	4	7	2,000		4	17	21
İ	i i	PRDWL	M12×1	64.3	46	37	4	7	300	44	4		
		PRD	M18×1	52.7	31	19	4	10	2,000	_	5		i
Non-	M18	PRDW	M18×1	52.7	31	19	4	10	300	44	5	24	00
flush	I MI I B	PRDL	M18×1	85.7	64	52	4	10	2,000	_	5	24	29
	اا	PRDWL	M18×1	85.7	64	52	4	10	300	44	5		
		PRD	M30×1.5	62	40.3	28	5	10	2,000		5		
	м30	PRDW	M30×1.5	62	40.3	28	5	10	300	44	5	35	42
	MISS	PRDL	M30×1.5	84	62.3	50	5	10	2,000	_	5	00	72
I		PRDWL	M30×1.5	84	62.3	50	5	10	300	44	5		

※ "G" type standard: Cable outgoing type/2,000mm, Cable outgoing connector type/300mm
※ "J" type: Ø4, 3 cores / Ø5, 3 cores (Conductor cross section: 0.3mm, Insulator diameter: Ø1.25)


Connections

	NPN	PNP
Connector	Black Blue 0 +V 3	2 1 Brown 0+V 3 4 Black Blue 00V

Mutual-interference & Influence by surrounding metals


When several proximity sensors are mounted closely, malfunction of sensor may be caused due to mutual interference Therefore, be sure to provide a minimum distance between the two sensors with referring to the chart below

Face to Face



OInfluence by surrounding metals


When sensors are mounted on metallic panel, it is required to protect the sensors from being affected by any metallic object except target. Therefore, be sure to provide a minimum distance as below chart.



(Unit:mm)

Model	PRD□12-4D□ PRDW□12-4D□	PRD□12-8D□ PRDW□12-8D□	PRD 18-7D PRDW 18-7D	PRD 18-14D PRDW 18-14D	PRD 30-15D PRDW 30-15D	PRD□30-25D□ PRDW□30-25D□
Α	24	48	42	84	90	150
В	24	36	36	54	60	90
l	0	11	0	14	0	15
ød	12	36	18	54	30	90
m	12	24	21	42	45	75
n	18	36	27	54	45	90

Setting distance

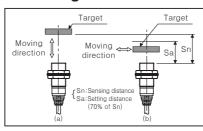


- Sensing distance can be changed by the shape, size or material of the target Therefore please check the sensing distance like (a), then pass the target within range of setting distance(Sa)
- Setting distance(Sa) Sensing distance(Sn) × 70% Ex)PRD18-7DN

Setting distance(Sa) = $7 \text{mm} \times 0.7 = 4.9 \text{mm}$

Caution for using

- his equipment shall not be used outdoors or beyond specified temperature range.
- 2. Do not apply over tensile strength of cord. (\(\phi 4: 30N \) max., \(\phi 5: 50N \) max.)

 3. Do not use the same conduit with cord of this unit and electric power line or power line
- 4. Do not put overload to tighten nut, please use the supplied washer for tightening



	Strength	Strength Front		Rear		
Model		Size	Torque	Torque		
PRD12	Flush	13mm	65kgf ⋅cm	120kgf · cm		
Series	Non-flush	7mm	(6.37N·m)	(11.76N·m)		
PRD18	Flush	_	150kg	ıf ·cm		
Series	Non-flush	-	(14.7	N·m)		
PRD30	Flush	26mm	500kgf · cm	800kgf · cm (78.4N · m)		
Series	Non-flush	12mm	(49N·m)			

Note1)Allowable tightening torque of a nut may be different by the distance from the head. For allowable tightening torque and the range of front and rear parts, refer to [Table 1] and above [Picture 1] respectively. The rear part includes a nut on the head side(see above [Picture 1]). Please apply a tightening torque of the front part when the nut on the front is located in the front part. Note2) The allowable tightening torque denotes a torque value when using a provided washer as above [Picture 2].

- Please check the voltage changes of power source in order not to excess rating power input.Do not use this unit during transient time(80ms) after apply power.
- . It might result in damage to this product, if use automatic transformer. So please use insulated transformer Please make wire as short as possible in order to avoid noise.
- 9. Be sure to use cable as indicated specification on this product. If wrong cable or bended cable is used, it shall not maintain the water-proof.
- 10. It is possible to extend cable with over 0.3mm² and max, 200m
- . If the target is plated, the operating distance can be changed by the plating material.
- 12 It may result in malfunction by metal particle on product
- 13. If there are machines(motor, welding etc), which occurs big surge around this unit, please install the varistor or absorber to source of surge, even though there is built—in surge absorber in this unit.

 14. If connecting the load with big inrush current(DC type bulb) to this unit, the big inrush current will flow since the initial resistance is low.
- If the current flows, the resistance of load will be bigger, then it will return to standard current. In this case, proximity sensor might be damaged by inrush current.
- If you use DC type bulb, please connect extra relay or resistance in order to protect proximity sensor from

Counters

Display units

■ Panel meters

■ Pressure sensors

■ Power controllers

*It may cause malfunction if above instructions are not followed.

Maior products

- Proximity sensors
- Photoelectric sensors
- Fiber optic sensors
- Door/Door side sensors
- Graphic/Logic panels
- emperature controllers ■ Tachometer/Pulse(Rate) meters

- mperature/Humidity transducers
- Switching power supplies

- Field network devices
- Laser marking system(CO₂, Nd:YAG)
- Laser welding/soldering system

Autonics Corporation

Satisfiable Partner For Factory Automation ■HEAD QUARTERS :

■OVERSEAS SALES : OVERSEAS SALES -Bldg. 402 3rd FL., Bucheon Techno Park, 193, Yakdae-dong Wonmi-gu, Bucheon-si, Gyeonggi-do, 420-734, Korea TEL: 82-32-610-2730 / FAX: 82-32-329-0728

The proposal of a product improvement and development :product@autonics.com

EP-KE-07-0480B

Autonics INDUCTIVE PROXIMITY SENSOR

LONG CYLINDRICAL TYPE DC 2WIRE

Thank you very much for selecting Autonics products. For your safety, please read the following before using.

Caution for your safety

**Please keep these instructions and review them before using this unit.

**Please observe the cautions that follow:

↑ Warning Serious injury may result if instructions are not followed.

▲ Caution Product may be damaged, or injury may result if instructions are not followed.


★The following is an explanation of the symbols used in the operation manual. **∆**Caution:Injury or danger may occur under special conditions

- 1. In case of using this unit with machinery (Ex: nuclear power control, medical equipment, ship, vehicle, train, airplane, combustion apparatus, safety device, crime/disaster prevention equipment, etc) which may cause damages to human life or property, it is required to install fail-safe device. It may cause a fire, human injury or damage to property.
- 2. Do not connect power directly without load.
- It may result in damage to inner components or burn them out.


∆ Caution

- 1. Do not use this unit in place where there are flammable, explosive gas, chemical or strong alkalis, acids. It may cause a fire or explosion
- 2. Do not impact on this unit.
- It may result in malfunction or damage to the product.
- 3. Do not supply AC power and observe the rated specification.
- It may result in serious damage to the product.

Ordering information

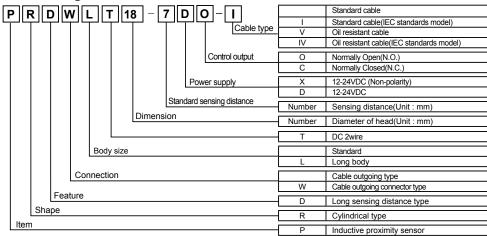

Connections

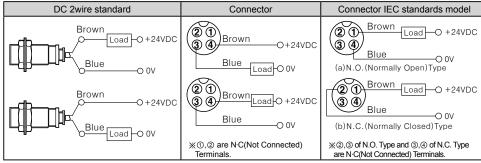

XLoad can be wired to any direction

No need to consider polarity for non-polarity type of power supply.

XThe above specifications are subject to change without notice.

Specifications

Model	PRD1124-TO PRD1124-TC PRD1124-TC PRD1124-TC PRD11124-TO PRD11124-TO PRD11124-TO PRD11124-TO PRDW1124-T	PROT128_C PROT128_C PROT128_C PROT128_C PROT128_C PROT128_C PROL1128_C PROL1128_C PROL1128_C PROW1128_C	RDT18-T_C RDT18-T_C RDT18-T_CV RDT18-T_CV RDT18-T_CV RDLT18-T_CV RDLT18-T_CV RDLT18-T_CV RDWT18-T_C RDWT18-T_C RDWT18-T_CV RDWT18-T_CV RDWT18-T_CV RDWT18-T_CV RDWT18-T_CV RDWT18-T_CV RDWT18-T_CV RDWT18-T_CV RDWT18-T_CV	PROTIS-14_O PROTIS-14_C PROWITS-14_C PRO	PRDT30-15_O PRDT30-15_OV PRDT30-15_OV PRDT30-15_OV PRDLT30-15_O PRDLT30-15_O PRDLT30-15_OV PRDUT30-15_OV PRDWT30-15_O PRDWT30-15_O PRDWT30-15_OV PRDWT30-15_OV PRDWT30-15_OV PRDWT30-15_OV PRDWT30-15_OV PRDWT30-15_OV	PRDT30:25 O PRDT30:25 O PRDT30:25 O V PRDT30:25 O V PRDT30:25 O V PRDLT30:25 O V PRDLT30:25 O V PRDLT30:25 O V PRDWT30:25 O V
Sensing distance	4mm	8mm	7mm	14mm	15mm	25mm
Hysteresis	Max. 10% of sensi	ng distance				
Standard sensing target	12×12×1mm(Iron)	25×25×1mm(Iron)	20×20×1mm(Iron)	40×40×1mm(Iron)	45×45×1mm(Iron)	75×75×1mm (Iron)
Setting distance	0 to 2.8mm	0 to 5.6mm	0 to 4.9mm	0 to 9.8mm	0 to 10.5mm	0 to 17.5mm
Power supply (Operating voltage)	12-24VDC (10-30VDC)					
_eakage current		5V for non-polarity t			,	
Response frequency (※1)		400Hz	250Hz	200Hz	100Hz	100Hz
Residual voltage (%2)	Max. 3.5V (Max.5V					
Affection by Temp.		of sensing distance	at 20°C in temperatur	e range of -25 ~ 70°C		
Control output	2 to 100mA	, , , , , , , , , , , , , , , , , , ,				
Insulation resistance	Max. 50MΩ (at 500\					
Dielectric strength Vibration	1,500VAC 50/60Hz		each of X, Y, Z direction	no for 2 hours		
Shock		directions for 3 times		IIS IOI 2 HOUIS		
Indicator	Operating indicator		•			
Ambient Temp.	-25 to 70°C, Storag	e:-30 to 80°C				
	35 to 95%RH, Stor					
Protection circuit Protection	IP67(IEC standard		y proteciton circuit, Ov	rescurrent protection		
			Nikel plated Iron, Sens	ing surface: Heat rooi	ictant ABS	
Materials	Standard cable(Bla	ck): Polyvinyl chlorid	e(PVC), Oil resistant of	cable(Gray): Oil resista	ant Polyvinyl chloride	(PVC)
Approval	C€	<u>, , , , , , , , , , , , , , , , , , , </u>	.,	, , , , , , , , , , , , , , , , , , , ,	, , , , , , , , , , , , , , , , , , , ,	/
Unit weight	PRDT :Approx. 74g PRDLT :Approx. 94g PRDWT :Approx. 44g	PRDT :Approx. 72g PRDLT :Approx. 92g PRDWT :Approx. 42g	PRDT :Approx. 115g PRDLT :Approx. 145g PRDWT :Approx. 80g PRDWLT :Approx. 110g	PRDT :Approx. 110g PRDLT :Approx. 140g PRDWT :Approx. 75g PRDWLT :Approx. 105g	PRDT :Approx. 175g PRDLT :Approx. 215g PRDWT :Approx. 140g	PRDT :Approx. 180g PRDLT :Approx. 220g PRDWT :Approx. 145g

- * 1: The response frequency is the average value. The standard sensing target is used and the width is set as 2 times of the standard sensing target, 1/2 of
- * 2: Before using non-polarity type, check the condition of connected device because residual voltage is 5V.

 * Condition for use in Environment is no freezing or condensation.

Dimensions

(Unit:mm) Cable outgoing type Cable outgoing connector type

туре		PRDT(N	И12, М18, N	130)		PRDWT(M12, M18, M30)					Nuta	vvasner
Flush	B #F											
Non- Flush	B *F *H					B	*	#F	G M12×1			
	Type		Α	В	С	D	E	F	G	Н	1	J
	M12	PRDT PRDWT PRDLT	M12×1 M12×1 M12×1	52 52 64	31.5 31.5 44	4 4	-	2,000 300 2,000	43.5	4 4 4	17	21
Flush	M18	PRDT PRDWT PRDLT PRDWLT	M18×1 M18×1 M18×1 M18×1	53 62 86 86	29.5 38.5 62 62	4 4 4	-	2,000 300 2,000 300	- 43.5 - 43.5	5 5 5 5	24	29
	М30	PRDT PRDWT PRDLT	M30×1.5 M30×1.5 M30×1.5	62 62 84	38 38 60	5 5 5	- - -	2,000 300 2,000	- 43.5 -	5 5 5	35	42
	M12	PRDT PRDWT PRDLT	M12×1 M12×1 M12×1	52 52 64	24.5 24.5 37	4 4	7 7 7	2,000 300 2,000	43.5	4 4 4	17	21
Non- Flush	M18	PRDT PRDWT PRDLT PRDWLT	M18×1 M18×1 M18×1 M18×1	53 62 86 86	19 29 52 52	4 4 4 4	10 10 10 10	2,000 300 2,000 300	- 43.5 - 43.5	5 5 5 5	24	29
	M30	PRDT	M30×1.5	62	28	5	10	2,000	- 42.5	5	25	42

PRDLT M30×1.5 84 50 X"F" type standard: Cable outgoing type/2,000mm, Cable outgoing connector type/300mm
X"H" type: ø4, 2 cores/ø5, 2 cores/Conductor cross section:0.3mm, Insulator diameter:ø1.25)

Control output diagram & Load operating


		Normally Open	Normally Closed
Brown Load O +V	Sensing target	Presence Nothing	Presence Nothing
Blue	Load	Operation Return	Operation Return
0V	Indicator (LED)	ON OFF	ON OFF

Multi-interference & Influence by surrounding metals

When several proximity sensors are mounted closely, malfunction of sensor may be caused due to mutual interference. Therefore, be sure to provide a minimum distance between the two sensors with referring to the chart below.


Parallel

Face to Face




Influence by surrounding metals

When sensors are mounted on metallic panel, it is required to protect the sensors from being affected by any metallic object except target Therefore, be sure to provide a minimum distance as below chart.



Model Item	PRDT12-4 DPRDWT12-4 DPRDLT12-4 DP	PRDT12-8 PRDWT12-8 PRDLT12-8	PRDT18-7	PRDT18-14		PRDT30-25 □ □ PRDWT30-25 □ □ PRDLT30-25 □ □
Α	24	48	42	84	90	150
В	24	36	36	54	60	90
ł	0	11	0	14	0	15
ød	12	36	18	54	30	90
m	12	24	21	42	45	75
n	18	36	27	54	45	90


Setting distance



- Sensing distance can be changed by the shape, size or material of the target Therefore please check the sensing distance like (a), then pass the target within range of setting distance(Sa)
- · Setting distance(Sa)
- = Sensing distance(Sn) × 70%
- Fx)PRDT18-7DO
- Setting distance(Sa) = 7mm × 0.7 = 4.9mm

Caution for using

- 1. This equipment shall not be used outdoors or beyond specified temperature range.
- Do not apply over tensile strength of cord. (ø4: 30N max., ø5: 50N max.)
 Do not use the same conduit with cord of this unit and electric power line or power line.
- 4. Do not put overload to tighten nut, please use the supplied washer for tightening



		Strength		Front	Rear	
	Model	lel Size Torque		Torque		
	PRDT12 Flush 13mm 65kgf · cm			120kgf ⋅cm		
=	Series	Non-flush	7mm	(6.37N·m)	(11.76N·m)	
	PRDT18	Flush	-	150kgf · cm (14.7N · m)		
ng et	Series	Non-flush	-			
	PRDT30	Flush	26mm	500kgf ·cm	800kgf · cm	
	Series	Non-flush	12mm	(49N·m)	(78.4N·m)	

Note1) Allowable tightening torque of a nut may be different by the distance from the head. For allowable tightening torque and the range of front and rear parts, refer to [Table 1] and above [Picture 1] respectively. The rear part includes a nut on the head side(see above [Picture 1]). Please apply a tightening torque of the front part when the nut on the front is located in the front part. Note2)The allowable tightening torque denotes a torque value when using a provided washer as above [Picture 2].

- Please check the voltage changes of power source in order not to excess rating power input.
- Do not use this unit during transient time(80ms) after apply power.
 It might result in damage to this product, if use automatic transformer. So please use insulated transformer.
- 8. Please make wire as short as possible in order to avoid noise.
- 9. Be sure to use cable as indicated specification on this product. If wrong cable or bended cable is used, it shall not maintain the
- 10. It is possible to extend cable with over 0.3mm² and max. 200m.
- 11. If the target is plated, the operating distance can be changed by the plating material.

 12. It may result in malfunction by metal particle on product.
- 13. If there are machines(motor, welding etc), which occurs big surge around this unit, please install the varistor or absorber to source of surge, even though there is built-in surge absorber in this unit.
- 14. If connecting the load with big inrush current(IDC type bulb) to this unit, the big inrush current will flow since the initial resistance is low. If the current flows, the resistance of load will be bigger, then it will return to standard current. In this case, proximity sensor might be damaged by inrush current. If you use DC type bulb, please connect extra relay or resistance in order to protect proximity sensor from
- 15. If making a transceiver close to proximity sensor or wire connection, it may cause malfunction
- 16. In case of the load current is small: Make the residual current is less than return current to connect the bleeder resistor to load in parallel

Counters

Timers


Display units

Panel meters

Pressure sensors

Vs:Power supply, Io:Min.operating current for proximity sensor, loff:Return current of load, P:Resistance W of Bleeder resistor

 $R \leq \frac{Vs}{lo-loff} (k\Omega) \quad P > -$



XIt may cause malfunction if above instructions are not followed

■ Major products

- Proximity sensors
- Photoelectric sensors
- Door/Door side sensors

- Graphic/Logic panels
- emperature controllers
- Tachometer/Pulse(Rate) meters
- Temperature/Humidity transducers
- Switching power supplies
- Stepping motors/drivers/motion controllers
- Field network devices
- Laser marking system(CO₂, Nd:YAG)
 Laser welding/soldering system

Autonics Corporation

Satisfiable Partner For Factory Automation

■HEAD QUARTERS :

41-5. Yongdang-dong, Yangsan-si, Gyeongnam, 626-847, ■OVERSEAS SALES :

IOVERSEAS SALES: Bldg. 402 3rd FL, Bucheon Techno Park, 193, Yakdae-dong, Wonmi-gu, Bucheon-si, Gyeonggi-do, 420-734, Korea TEL: 82-32-610-2730 / FAX: 82-32-329-0728

The proposal of a product improvement and

development :product@autonics.com EP-KE-07-0490C